



# Callisto GM 4L60E 4Speed

Last Changed: 23/12/2025 Page 1 of 2

Harness Required: E71-P1, E62-P2, E63-P3, P07-Coms, CON1


Transmission Connector

NB! Transmission Connector Pin View

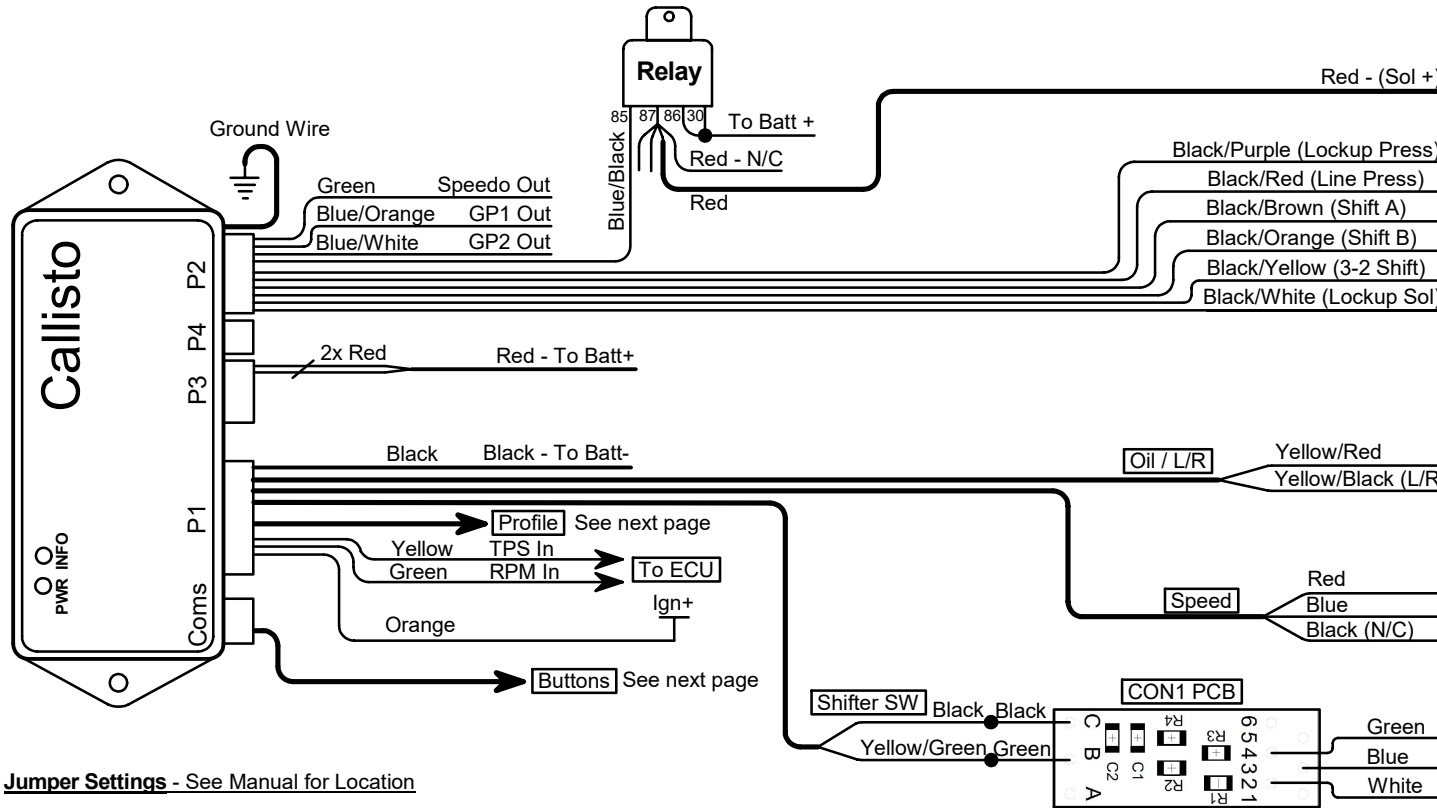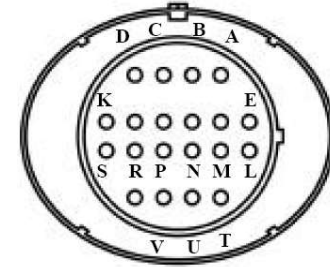

Pin	Harness	Spits Color	Connector	Resistance	
				Cold	Hot
A	Gearbox	Black/Brown	Shift A	P2-7	20 40 Ω
B	Gearbox	Black/Orange	Shift B	P2-1	20 40 Ω
D	Gearbox	Black/Red	Line Pres	P2-6	3,5 4,6 Ω
C&E	12V	Red	Sol+		
K	Speed	Red	SP-	P1-5	
L	Oil	Yellow/Red	TOT	P1-7	
M	Oil	White	TOT	P1-GND	
N	CON1 PCB	White	Switch A		
P	CON1 PCB	Blue	Switch C		
R	CON1 PCB	Green	Switch B		
S	Gearbox	Black/Yellow	3-2 Shift	P2-8	9 14 Ω
T	Gearbox	Black/White	Lockup Sol	P2-3	20 40 Ω
U	Gearbox	Black/Purple	Lockup Pres	P2-1	9 14 Ω
V	Speed	Blue	SP+	P1-11	




Jumper Settings - See Manual for Location

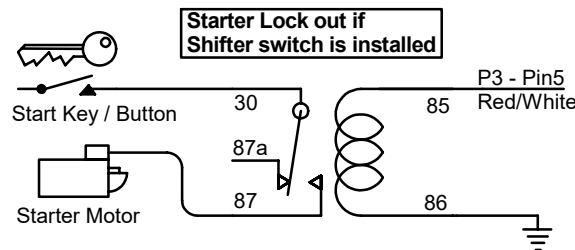


# GM 4L60E 4Speed

Last Changed: 14/08/2025 Page 2 of 2


Harness Required: E71-P1, E62-P2, E63-P3, P07-Coms, CON2

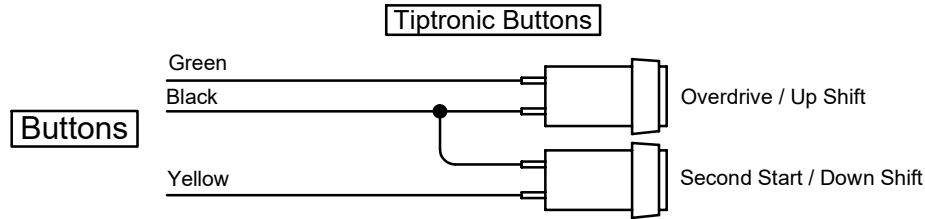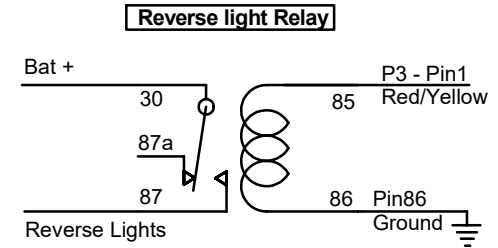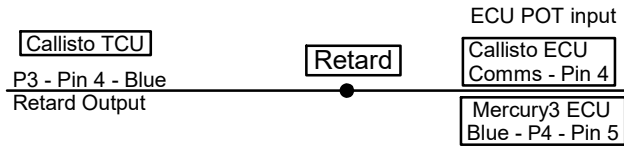

Note this feature requires the P07 Harness

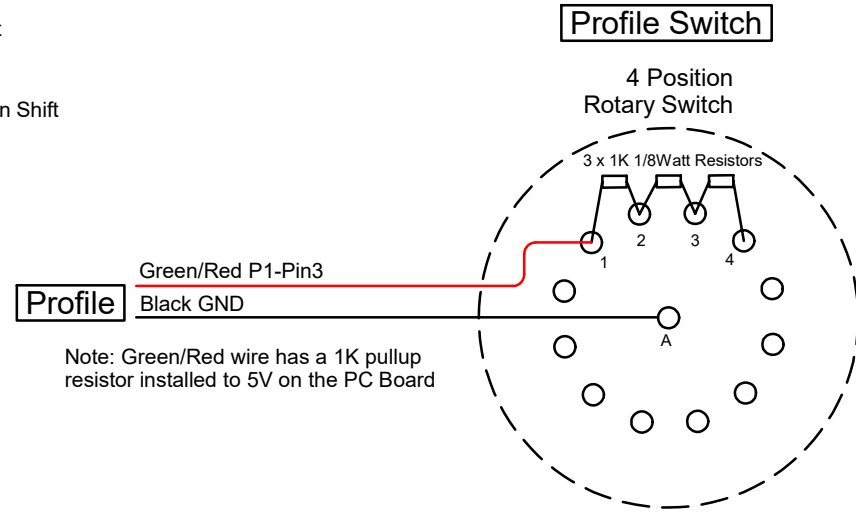

Note: Green/Red wire has a 1K pullup resistor installed to 5V on the PC Board



NB! Resistors are required for LED's

Ign+  
 Ignition Power  
 Earth  
**Terminal Connections with the same name are tied together**

**Note:** Harnesses pin-outs and colours are layed out on the GP Priority Sheet